# PERFORMANCE ANALYSIS OF HORIZONTAL IRREGULAR BUILDINGS BASED ON RESPONSE SPECTRUM AND TIME HISTORY METHOD (STUDY CASE: BUILDING MRT HUB DUKUH ATAS JAKARTA)

by Agnes Sri Mulyani

**Submission date:** 14-Dec-2023 10:37AM (UTC+0700)

**Submission ID:** 2258519657

File name: PerformanceAnalysisofHorizontalIrregular.pdf (778K)

Word count: 4789

Character count: 25777



### PERFORMANCE ANALYSIS OF HORIZONTAL IRREGULAR BUILDINGS BASED ON RESPONSE SPECTRUM AND TIME HISTORY METHOD (STUDY CASE: BUILDING MRT HUB DUKUH ATAS JAKARTA)

Steffy Catharina Rebeccha Simbolon<sup>1\*</sup>, Sudarno P. Tampubolon<sup>2</sup>, Agnes Sri Mulyani<sup>3</sup>

1,2,3 Program Studi Teknik Sipil, Fakultas Teknik, Universitas Kristen Indonesia

Jalan Mayor Jendral Sutoyo, Cawang, Jakarta Timur, DKI Jakarta, 13630, Indonesia

\*1 steffycatharina@gmail.com 2sudarno.tampubolon@uki.ac.id 3agnes.mulyani@uki.ac.id





### Abstract

Indonesia is geographically located in the Pacific ring of fire, especially on Java Island, which has the densest infrastructure and population and is located between the Indo-Australian plate and the Eurasian plate, causing this area to have mail active volcanoes and has a high potential for earthquakes. Therefore, it is necessary to pay the planned earthquake load in planning the building structure design to minimize losses due to the earthquake. This study aims to determine the structure's performance against displacement, story drift, and structural stability limits against earthquake loads and to review horizontal structural irregularities based on SNI 1726: 2019 regulations in existing buildings at the Simpang Temu MRT Dukuh Atas Jakarta building. The analysis process was carried out by 3-D building modeling using the ETABS software program, analysis based on time history and sresponse, spectrum Time History analysis uses recorded arthquakes of Kobe Japan, ChiChi Taiwan, and El Centro which match the earthquake response spectrum, the results of the analysis based on the program were carried out to compare the two methods used. Based on the results of the analysis, the building is classified into horizontal irregularities with excessive torque ratio > 1.4, average displacement value from the 2nd to 12th floor in the horizontal direction X exceeds the drift value limit. The results of the instability limit for structural stability against displacement based on the P-Delta effect still meet the structural stability limits so it can be stated that the structure is stable and safe.

**Keywords:** Horizontal Irregularity, Response Spectrum, Time History, Displacement, Story Drift, P-Delta

### Introduction

Indonesia's territory is located on the Pacific Ring of Fire and is located at the confluence of 3 major tectonic plates in the world, so that Indonesia's geographical location provides abundant natural resource potential, but also makes Indonesia a very disaster-prone 27 country, especially earthquakes (Nehe et al., 2021; S. P. Tampubolon et al., 2020; Tjandra, 2017; Triany et al., 2022). Problems caused by earthquakes can be in terms of material, physical and psychological casualties. Therefore, it is necessary to take preventive measures by designing earthquake - resistant building structures to be able to withstand and minimize damage caused by earthquakes, (LE et al., 2019; Samsunan, 2018; S. P. Tampubolon et al., 2022a). Therefore, building and non-building structures in every planning and developmen 31 must be earthquake resistant, so that if an earthquake occurs the building does not cause major damage (Gonzales, 2022; Hariyanto, 2011; S. P. Tampubolon et al., 2022b; Tatya Putri Utami & Niken Warastuti, 2019). Based on the Indonesian earthquake guide which was inaugurated in 2019 (SNI 1726:2019) Indonesia is divided into several earthquake areas according to their respective risk levels according to the rock acceleration value of each sector. The magnitude of the rock acceleration value is then used as the basic seismic acceleration coefficient in seismic force calculations (Badan Standarisasi Nasional, 2019). The response structure due to seismic 26 orces can be obtained by equivalent static analysis and also dynamic analysis using the method of range response spectra and seismic response time history. Meanwhile, determining the seismic analysis procedure that can be used depends on the seismic design category, the structure of the system itself, dynamic properties, and the regularity of the structure. (Saputra et al., 2021; Yusmar et al., 2021). Therefore, research was carried out on buildings that have irregular structures and different structural dimensions on certain floors and use res<mark>119</mark>nse spectrum analysis and time history based on SNI 1726:2019 concerning

Standards for Earthquake Resistance Planning for Buildings. Several previous studies regarding irregularities strengthening concrete building structures and building analysis using response spectrum and time history methods have been carried out by several researchers, (Bayyinah & Faimun, 2017a; Rendra et al., 2015). Kharisma in 2022 conducted research on the performance analysis of the structure of the Indonesian University of Education (UPI) using the time history method by forces, taking into account shear displacements, and story drift, (Andrivanto & Setiya Budi, 2014; S. Tampubolon, 2021). The results show that the structure meets the requirements that the structure mate the deviation permit limits, and states that the level of the building structure includes the Immediate Occupancy (IO) level which states that there is no serious damage to the structure (Kharisma, 2022). Taufik in 2821 discussed the earthquake loads of San Fernando, Loma Prieta, and Kobe by adjusting the location of the building, using the SeismoMatch 2021 software. The analysis being reviewed is the fundamental period, the variety of vibrations, and excess torque irregularities. The results of the analysis show that the structure has torsional structural irregularities (Alavi-Dehkordi et al., 2019; Taufik et al., 2021). In research that analyzes area using the 10 namic time history analysis method aims to determine the performance of building structures based on their displacements, (Sudarno P Tampubolon, 2021; S. Tampubolon, 2021). The research nethod used is dynamic response spectrum with ETABS software. The result of the analysis due to the planned 12 rthquake is that the structure is safe and is included in the immediate occupancy category. The results of the analysis due to the actual earthquake were, Elcentro: unsafe structure on Floor 1 -Roof, the structure is in the damage control category, Northridge: structure is not safe on floor 10 and floor roof, but still in the immediate occupancy category, Mentawai: structure is safe and into the immediate occupancy category. (Anggen et al., 2013. From the results of the research above, it is necessary to analyze the structural performance of buildings that have been completed, (Ibnu Syamsi, 2018; Kimsan & Perceka, 2013; Priyono et al., 2014). While the case study taken is an office building consisting of 12 floors and 2 basements. However, this research only focuses on the upper structure of the building. This building is located in the Jakarta area with earthquake area 4, where in the earthquake area 4 is the building area, SNI 1727:2020 concerning Minimum Design Loads and Related Criteria for Buildings and Other Structures, and SNI 2847:2019, (ACI Committee 318, 2019) concerning structural concrete requirments fot building.

### Research Methodology

This research used analysis and simulation method based on dynamic linear analysis of response spectrum and linear time history

analysis on the MRT Hub Dukuh Atas Jakarta building using ETABS software. The steps taken in evaluating the structure are collecting data on building plans, modeling building structures, modeling material 13ality, and modeling structural elements starting from columns, beams, slabs, and roofs into the ETABS software 23 he loads applied are gravitational loads (dead loads, additional dead loads, and live loads) plus earthquake accelerating loads (planned earthquakes and actual earthquakes). The results of analysis due to planned earthquakes and actual earthquakes are analyzed to determine the performance and level of structural performance as well as the qualifications for horizontal structural irregularities adjusted according to SNI 1726: 2019 regulations, (ACI committee 318, 2011; Mandloi et al., 2017; Nagod, 2017; Rathod & Gupta, 2020; Zhai & Chen, 2020) (Silaban et al., 2023).

Table 1. Building information data

No	<b>Buliding Description</b>	Information
		MRT Transport and Facilities Intersection Building
1	Project Name	Supporters in the Dukuh Atas Transit Oriented Area, Central
		Jakarta.
2	Project Address	Juana Street, No.30, District Menteng, Central Jakarta.
3	Building Function	MRT Office, transit oriented, and retail.
4	Building Coordinate	Latitude : 106.82383004089631
		Longitude : -6.201216641221554,
5	Building Area	17,719 m <sup>2</sup>
6	Building Height	57.7 m
7	Building Type	Concrete Reinforcement
8	Number of Floors	2 floor basement and 12 floor with rooftop.

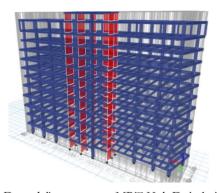


Figure 1. 3-D modeling structure MRT Hub Dukuh Atas Jakarta



### Research Results and Discussion

Modeling the loads acting on the analyzed building must be done first so that structural modeling analysta can be carried out (Nie et al., 2020). This aims to determine the response of a structure to the design of a building model in carrying the load received, especially earthquake loads. The following is a discussion of the results of the analysiso or simulation that has been carried out on buildings at MRT Hub Dukuh Atas Jakarta. Gravity load is a load that is affected by the gravitational force of the earth. In building structures and non-buildings, this load is divided into additional dead loads and live loads based on the building filling components and the floor function of the building (Badan Standardisasi Nasional, 2019; SNI 1727, 2020; SNI 2847:2019, 2019).

Table 2. Structure weight

Story	Total Load in X (kN)	Total Load in Y (kN)
Roof	125414.1956	125414.1956
LMR	752751.7552	752751.7552
12	1035716.915	1035716.915
11	1031329.768	1031329.768
10	1043564.45	1043564.45
9	1025408.005	1025408.005
8	1042712.44	1042712.44
7	1050036.706	1050036.706
6	1046337.506	1046337.506
5	1071882.215	1071882.215
4	1132099.58	1132099.58
3	1159839.637	1159839.637
2	1150735.512	1150735.512
1	194517.4918	194517.4918
Total weight	12862346.18	12862346.18

In linear dynamic response spectrum analysis, spectral response parameters must be calculated first by knowing the site coefficient values can be obtained by calculating the RSA Cipta Karya software. Whereas in the dynamic linear analysis of

time history, based on SNI 1726, at least 3 recordings of ground motion acceleration due to the earthquake are selected and then the time history graph is matched with the spectral response graph (Bayyinah & Faimun, 2017b; Herucahyo et al., 2015; PuSGen, 2018; Suntoko, 2019).

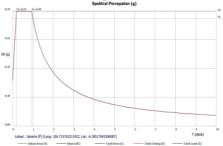


Figure 2. Response spectrum MRT Hub Dukuh Atas Jakarta

Table 3. Earthquake data and structure system

Earthquake Acceleration Data					
Site Class	:	= SE (Soft Soil)			
Seismic Design Category,	KDS =	= D			
Short Period Acceleration Spectral,	S <sub>s</sub> =	= 0.7975			
1 Second Period Spectral Acceleration,	S <sub>1</sub> =	0.3879			
Site Coefficient,	$F_a$ =	1.262			
	$\overline{F_r} =$	2.4484			
Short Period Design Acceleration,	$S_{DS} =$	0.67			
1 Second Period Design Acceleration,	$S_{Dt} =$	0.67			
Structural Syste	m Para	meters			
Earthquake Priority Factor,	$I_{\varepsilon}$ :	= 1.00			
Response Modification Coefficient,	R =	= 7			
Strong Factor Over System,	$\Omega_0$ =	= 2.5			
Deflection Magnification Factor,	C <sub>d</sub> =	= 5.5			

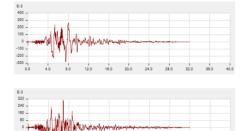


Figure 3. Acceleration earthquake Kobe University Japan (up) X, (down) Y

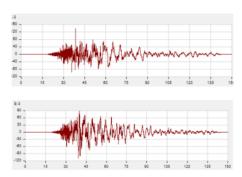


Figure 4. Acceleration earthquake ChiChi Taiwan (up) X, (down) Y

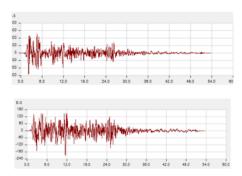


Figure 5. Acceleration earthquake EI centro 1940 (up) X, (down) Y

Based on 5 II 1726:2019 the analysis must include a sufficient number of variations to obtain a combined mass participation of 100% of the structure, but as an alternative, the analysis is

permitted to inclute a minimum number of combined modes of 90% of the actual mass in each orthogonal horizontal direction of the response reviewed by the model.

Table 4. Modal participating mass ratio

17				
Case	Mode	Period	$\mathbf{U}\mathbf{X}$	$\mathbf{U}\mathbf{Y}$
Modal	1	25.345	0.0005	0.3134
Modal	2	21.008	0.0269	0.7257
Modal	3	19.963	0.7458	0.7377
Modal	4	7.377	0.746	0.7615
Modal	5	6.194	0.7469	0.8496
Modal	6	5.753	0.8559	0.8499
Modal	7	4.047	0.8559	0.8544
Modal	8	3.07	0.8559	0.9041
Modal	9	2.85	0.9112	0.9041
Modal	10	2.647	0.9117	0.907
Modal	11	1.859	0.9121	0.9113
Modal	12	1.797	0.9123	0.9365

The results of the ETABS program, it was found that the value of combined mass participation in the numb of shape modes 12 shows that the value in the X direction reached 0.9123 (91.23%) and in the Y direction reached 0.9365 (93.65%). These results stated that mass participation could be permitted because it had met the minimum limit of  $\geq 90\%$  in the X and Y directions.

Table 5. Structure period control

Structure Period Control					
1 Second Period Design Acceleration,	SD1	=	0.63316	g	
Coefficient for Period	Cu Ct		1.4 0.0488		
	x	=	0.75		
Building Height (Seismic),	h	=	57.7	m	
Period Fundamental Approach,	Та		Ct × hx 1.02165	sec	
Maximum Period,	Tmax		Cu × Ta 1.43031	sec	
Analysis Result Period (X),	Tc, X	=	1.808	sec	
Analysis Results Period (Y),	Тс, Ү	=	1.879	sec	
(*/)		_			

367

### 4 Jurnal Pensil : Pendidikan Teknik Sipil

Period use X,	TX	=	1.43031	det	_
Period use Y,	TY	=	1.43031	det	

Based on Tabl 12, the building under study uses a special moment bearing frame system (SRPMK) with a reinforced concrete frame so that table 4 uses a respo 2 emodification coefficient (R) = 7. Because the value of the seismic response coefficient and the total weight of the building in the x and y directions are the same, the value of V is

785127.04 kN. Force scaling to sed on article 7.9.1.4.1 SNI 1726:2019 if the combined response for the base shear force analysis of variance (V dynamics) is less than 100% of the base shear force value (V) calculated using the equivalent static method, then the value of the force scale factor is 6 cessary multiplied by (Vstatic/Vdynamic). Based on the results of analysis 28 culations, the shear force (base reaction) of static and dynamic earthquakes is presented in table 6.

Table 6. Comparison of static fear shear force (VS) and dynamic shear (VD) values

Base Shear		D	), kN		
	Static Shear Force (V <sub>S</sub> )	Response Spectrum MRT Hub Dukuh Atas	Time History Kobe Univ Japan	Time History ChiChi Taiwan	Time History El Centro (1940)
X	524222.6589	88905.449	33556.1665	32085.55	33262.394
Y	524357.8026	72571.5239	25997.28919	32903.9331	27198.3639

Based 10 table 6, it is obtained that the comparative value of the dynamic shear force 10 D) does not exceed or equal to 100% of the value of the static shear force, therefore it is necessary to scale the force by multiplying the initial scale factor by the scale factor (Vs/VD).

Table 7. shows the style scaling analysis table.

Initial scale factor =  $(g/(R/Ie) \times 1000$ New scale factor = initial Fs x Fs (Vs/VD)

The new scale factor will be entered into the ETABS for scaling.

Table 7. Static and dynamic shear forces after scalling

Load Case	Shear Value Comparasion (V <sub>S</sub> /V <sub>D</sub> )		_ Initial Scale Factor	New Scale Factor (mm/s²)	
	X	Y	$(mm/s^2)$	X	Y
Response Spektrum MRT Hub Dukuh Atas	5,90	7.23		8260.571	10122.41
Time History Kobe Japan	15,62	20,17	1400,95	21885.98	28256.76
Time History Chichi Taiwan	16,34	15,94	_	22889.11	22325.57
Time History El – Centro 2002	15,76	19,28	_	22079.28	27008.94

Based on the scaling performed on the values of the static shear force (VS) and the

dynamic shear force (VD), the values of the static shear force and dynamic shear force are obtained as shown in Table 6. The story drift ( $\Delta$ ) needs to be reviewed to determine the 21 el of flexibility in structural performance based on article 7.8.6 SNI 1726:2019, but may n<sub>6</sub> exceed the allowable drift between levels based on article 7.12.1 Table 20 SNI 1726:2019. Figure 7, 8, an<sub>22</sub> shows that the deviation between levels that occurs in the analyzed building is still at a safe point (below the value of the drift limit).

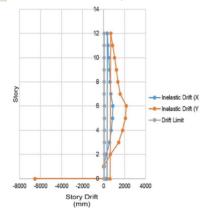


Figure 6. Story drift of earthquake loads response spectrum

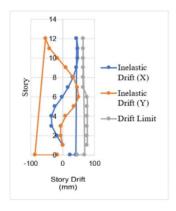


Figure 7. Story drift of earthquake loads Kobe University, Japan

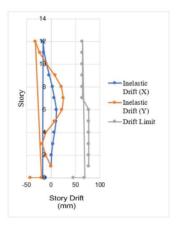


Figure 8. Story drift of earthquake loads ChiChi Taiwan

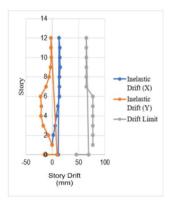


Figure 9. Story drift of earthquake loads EI centro 1940

The effect of P-Delta on story shear and moment, resulting structural element forces and moments, and the drift between stories need to be taken into account to determine 11 e value of the stability coefficient. The stability coefficient ( $\theta$ ) must not exceed  $\theta$ max, which is determined by  $0.5/(\beta \ge 0)$  less than or equal to 0.25. If the stability of the structure exceeds the stability limit of the structure, then the structure metal be redesigned. Meanwhile, if the stability of the structure exceeds the P-delta effect limit, then the structure must take into account the P-delta effect.



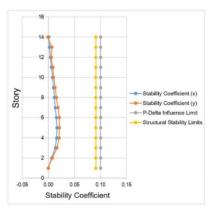


Figure 10. Stability against the influence of P-Delta earthquake response spectrum

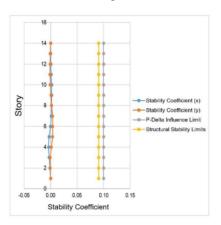


Figure 11. Stability against influence of P-Delta Kobe University Japan earthquake

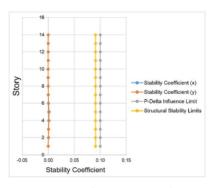


Figure 12. Stability against influence of P-Delta ChiChi Taiwan earthquake

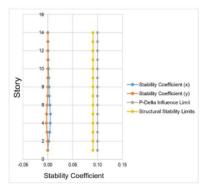


Figure 13. Stability against influence P-Delta EI centro 1940 earthquake

Irregular shapes in the building structure of the MRT Hub Dukuh Atas Jakarta Building, so it is necessary to classify the building based on SNI 1726-2019 while the qualifications for horizontal irregularities buildings are as follows:

- 1. Torsion irregularities and overtorsions (1a and 1b).
- 2. Irregularity of the inner angle.
- 3. Irregularity discontinuity of the diaphragm.
- 4. Irregulear displacement across the plane.
- 5. Nonparallel system irregularities.

	X		Y	
Story	$\Delta_{ m max}/\Delta_{ m avg}$	Check	$\Delta_{ m max}/\Delta_{ m avg}$	Check
Rooftop	1.021	OK	1.16	OK
LMR	1.048	OK	1.528	H.1b
12	1.033	OK	1.451	H.1b
11	1.022	OK	1.43	H.1b
10	1.014	OK	1.447	H.1b
9	1.01	OK	1.467	H.1b
8	1.009	OK	1.475	H.1b
7	1.008	OK	1.496	H.1b
6	1.014	OK	1.536	H.1b
5	1.019	OK	1.561	H.1b
4	1.024	OK	1.58	H.1b
3	1.034	OK	1.624	H.1b
2	1.045	OK	1.671	H.1b
1	0	OK	0	OK

Figure 14. Horizontal irregularity checking 1a and 1b

Based on Figure 10, the average ratio value on each floor is more than 1.4. This shows that the Simpang Temu Jakarta MRT building has type 1b horizontal irregularity.

Next check for irregularities in the inner angle. It is said that if Lx/Px and Ly/Py > 0.15 however, if only one of them has a value > 0.15 it cannot be said to be an sorgular inner angle. Checking the structure of the building under study can be seen as described below:

 $\begin{array}{lll} Lx & = 69.6 \text{ m} \\ Px & = 25.675 \text{ m} \\ Ly & = 13.154 \text{ m} \\ Py & = 3.454 \text{ m} \\ Lx/Px = 0.1890 \text{ m} \\ Ly/Py = 0.13 \text{ m} \\ Information: \end{array}$ 

Lx = Overall length of the building

Px = Length of the largest opening

Ly = Overall width of the building

Py = Width of the largest opening

Because Lx/Px is greater than 0.15 and Ly/Py is less than 0.15, it can be said that this building has no internal corner irregularities. The next check is on the irregularity of the diaphragm discontinuity. It is said to be an irregular diaphragm discontinuity if the opening area is >50% of the floor area of the building.

Total floor area = 1742 m2 Largest opening area = 71,534 m2 so,  $\frac{\text{Opening Area}}{\text{Total Area}}$ =  $\frac{223,734}{71,534}$ = 0.041 < 0.5

24

This indicates that the building structure does not experience irregular diaphragm discontinuities.

Irregularities due to shifts perpendicular to the plane did not occur in the MRT Hub Dukuh Atas Jakarta under review, because all the shear walls continued from the base to the roof of the building.

Nonparallel system irregularities do not occur in the MRT Hub Dukuh Atas Jakarta Intersection Building under review, because all the shear walls are right on the x and y axes.

### 15 Conclusion

Based on the results of analysis that has been carried out, it can be concluded that MRT Hub Dukuh Atas Jakarta Building has a horizontal irregularity of type 1b with maximum delta ratio in the Y directi 6 > 1.4. analysis provides time history information about the behavior of the structure against vibrations generated through earthquake recorded data every second with the accessogram recorded values entered, from the results of the analysis carried out also obtained the value of the mass participation ratio in in the x direction it reaches 0.9123 (91.23%) and in the y direction it reaches 0.9365 (93.65%). This result is still permitted be 25 se it meets the minimum limit of  $\geq 90\%$  in both the x and y directions. In story drift, response spectrum analysis shows that the horizontal structural plane in the x direction has weak stiffness against the influen of earthquake loads when compared to the y direction, however for the time history of the Kobe, Chichi and El - Centro earthquakes still meets the drift limits and the p delta effect there is no need to re-model because it is still safe limits.

### References

ACI committee 318. (2011). Building Code Requirements for Structural Concrete and Commentary (ACI 318M-11). In American Concrete Institute, Farmington Hills, MI.

ACI Committee 318. (2019). Building Code Requirements for Structural Concrete (ACI 318-19) and Commentary on Building Code Requirements for Structural Concrete (ACI 318R-19). In American Concrete Institute.

Alavi-Dehkordi, S., Mostofinejad, D., & Alaee, P. (2019). Effects of high-strength reinforcing bars and concrete on seismic behavior of RC beam-column joints. *Engineering Structures*, 183, 702–719. https://doi.org/10.1016/j.engstruct.2019.01.019

- Andriyanto, F., & Setiya Budi, A. (2014).

  EVALUASI KINERJA STRUKTUR
  GEDUNG BERTINGKAT
  DENGAN ANALISIS RIWAYAT
  WAKTU TERHADAP DRIFT DAN
  DISPLACEMENT
  MENGGUNAKAN SOFTWARE
  ETABS (STUDI KASUS: HOTEL
  DI DAERAH KARANGANYAR).

  Jurnal Matriks Teknik Sipil, 2(1).
- Anggen, W. S., Setiya Budi, A., & Gunawan, P. (2014). Evaluasi Kinerja Struktur Gedung Bertingkat dengan Analisis Dinamik Time History Menggunakan Etabs (Studi Kasus: Hotel di Daerah Karanganyar). E-Jurnal MATRIKS TEKNIK SIPIL, 8(1).
- Badan Standardisasi Nasional. (2019). SNI 1726:2019. Tata Cara Perencanaan Ketahanan Gempa Untuk Struktur Bangunan Gedung Dan Non Gedung.
- Badan Standarisasi Nasional. (2019). SNI 1726:2019 (Tata Cara Perencanaan Ketahanan Gempa Untuk Struktur Bangunan Gedung dan Non Gedung). SNI 1726:2019.
- Bayyinah, D. A. L. N., & Faimun, F. (2017a). Studi Perbandingan Analisis Respon Spektra dan Time History untuk Desain Gedung. *Jurnal Teknik ITS*, 6(1). https://doi.org/10.12962/j23373539. v6i1.21617
- Bayyinah, D. A. L. N., & Faimun, F. (2017b). Studi Perbandingan Analisis Respon Spektra dan Time History untuk Desain Gedung. *Jurnal Teknik ITS*, 6(1). https://doi.org/10.12962/j23373539.

v6i1.21617

Gonzales, R. (2022). Memaksimalkan potensi generasi muda di industri pertambangan untuk meningkatkan ekonomi Indonesia menuju Indonesia Emas 2045: Generasi Muda Untuk Bangsa. *Jurnal Himasapta*, 7(1). https://doi.org/10.20527/jhs.v7i1.53

- Hariyanto, A. (2011). ANALISIS KINERJA
  STRUKTUR PADA BANGUNAN
  BERTINGKAT TIDAK
  BERATURAN DENGAN
  ANALISIS DINAMIK
  MENGGUNAKAN METODE
  ANALISIS RESPONS SPEKTRUM
  Peformance. Universitas Sebelas Maret,
  Surakarta.
- Herucahyo, D. P., Purwanto, E., & Supriyadi, A. (2015). EVALUASI KINERJA STRUKTUR BANGUNAN BERTINGKAT TERHADAP GEMPADENGAN ANALISIS RESPON SPEKTRUM DAN RIWAYAT WAKTU MENGGUNAKAN ETABS STUDI KASUS:RUMAH SAKIT UNS. Matriks Teknik Sipil.
- Ibnu Syamsi, M. (2018). Respon Model Gedung Beton Bertulang dengan Penambahan Dinding Pengisi terhadap Beban Gempa. *Semesta Teknika*, 21(1). https://doi.org/10.18196/st.211208
- Kharisma, R. dkk. (2022). ANALISIS KINERJA STRUKTUR PADA GEDUNG MENGGUNAKAN METODE TIME HISTORY ANALYSIS. FTSP Series: Seminar Nasional Dan Diseminasi Tugas Akhir 2022, 26–38.
- Kimsan, M., & Perceka, W. (2013).

  PERFORMANCE LEVEL

  EVALUATION OF SHEAR WALL

   FLAT SLAB SYSTEM BY

  CONDUCTING STATIC

  EQUIVALENT ANALYSIS,

  RESPONSE SPECTRUM, LINEAR

  TIME HISTORY ANALYSIS AND

  NONLINEAR TIME HISTORY

  ANALYSIS. 6th Civil Engineering

  Conference in Asia Region: Embracing The

  Future Through Sustainability.
- LE, H., P, S., & S, T. (2019). Peningkatan Kesadaran Masyarakat terhadap Kerusakan Bangunan dan Lingkungan Pasca Gempa, Tsunami dan Likuifaksi di Palu Sulawesi Tengah. *JURNAL*

- Comunità Servizio: Jurnal Terkait
  Kegiatan Pengabdian Kepada Masyarakat,
  Terkhusus Bidang Teknologi,
  Kewirausahaan Dan Sosial
  Kemasyarakatan.
  https://doi.org/10.33541/cs.v1i2.129
- Mandloi, P., Chaturvedi, R., & Author, C. (2017). Seismic Analysis of Vertical Irregular Building with Time History Analysis. IOSR Journal of Mechanical and Civil Engineering (IOSR-JMCE) e-ISSN, 14(4).
- Nagod, S. (2017). SEISMIC ANALYSIS OF MULTISTOREYED RC BUILDING DUE TO MASS IRREGULARITY BY TIME HISTORY ANALYSIS. International Research Journal of Engineering and Technology (IRJET), 4(8).
- Nehe, E., Simanjuntak, P., & Tampubolon, S. P. (2021). Evaluation of the performance of high-rise building structures with plan "H" shaped for earthquake with height increase (Case study: Apartment Urban Sky-Bekasi). IOP Conference Series: Earth and Environmental Science, 878(1). https://doi.org/10.1088/1755-1315/878/1/012053
- Nie, X., Zhang, S., Jiang, T., & Yu, T. (2020). The strong column—weak beam design philosophy in reinforced concrete frame structures: A literature review. In *Advances in Structural Engineering*. https://doi.org/10.1177/1369433220 933463
- Priyono, A., Budi, A. S., & Supardi. (2014). Evaluasi Kinerja Struktur Gedung 10 Lantai Dengan Analisis Respons Spektrum Ditinjau Pada Drift dan Displacement Menggunakan Software ETABS. Matriks Teknik Sipil, 2009.
- PuSGen, T. (2018). Kajian Gempa Palu Provinsi Sulawesi Tengah 28 September 2018 (M7.4). In Pusat Litbang Perumahan dan Pemukiman, Balitbang PUPR Pusat.

- Rathod, K. V., & Gupta, S. (2020). A Nonlinear Time History Analysis of Ten Storey RCC Building. *International Research Journal of Engineering and Technology (IRJET)*, 7(06).
- Rendra, R., Kurniawandy, A., & Djauhari, Z. (2015). KINERJA STRUKTUR AKIBAT BEBAN GEMPA DENGAN METODE RESPON SPEKTRUM DAN TIME HISTORY (Studi Kasus: Hotel SKA Pekanbaru). Jom Fteknik, 2(2).
- Samsunan, S. (2018). EVALUASI
  KERUSAKAN AKIBAT GEMPA
  PADA BANGUNAN GEDUNG
  BANK ACEH CABANG SIGLI.

  Jurnal Teknik Sipil Dan Teknologi
  Konstruksi, 2(2).
  https://doi.org/10.35308/jtsutu.v2i2.377
- Saputra, M. R., Alami, F., & ... (2021). Studi Kinerja Gedung Empat Tingkat Terhadap Beban Gempa Dengan Metode Statik Pushover. *Jurnal Rekayasa Sipil Dan ..., 8*(1).
- Silaban, G. T. N., Tampubolon, S. P., Sri Mulyani, A., & Felestin. (2023). Performance Evaluation of High-rise Buildings with Respons Spectrum Analysis and Time History Analysis. Science Tech: Jurnal Ilmu Pengetahuan Dan Teknologi, 9(1), 84–95. https://doi.org/10.30738/st.vol9.no1 .a14295
- SNI 1727. (2020). Beban Desain Minimum dan Kriteria Terkait Untuk Bangunan Gedung dan Struktur Standarisasi Nasional. In *Sni 1727-2020* (Issue 8).
- SNI 2847:2019. (2019). Persyaratan Beton Struktural untuk Bangunan Gedung dan Penjelasan (SNI 2847:2019). Badan Standardisasi Nasional.
- Sudarno P Tampubolon. (2021). ANALISA PERBANDINGAN HASIL PENGUJIAN LABORATORIUM DAN SIMULASI PADA BALOK BETON BERTULANG. PADURAKSA: Jurnal Teknik Sipil

- *Universitas Warmadewa*. https://doi.org/10.22225/pd.10.1.26 32.195-210
- Suntoko, H. (2019). Analisis Spektrum Respon Desain Gedung Reaktor RDE Menggunakan SAP2000. *Jurnal Pengembangan Energi Nuklir*, 21(1). https://doi.org/10.17146/jpen.2019. 21.1.5047
- Tampubolon, S. (2021). Analisis Kekuatan Geser Pada Hubungan Balok-Kolom Interior Beton Bertulang. JOURNAL OF CIVIL ENGINEERING BUILDING AND TRANSPORTATION. https://doi.org/10.31289/jcebt.v5i1. 3731
- Tampubolon, S. P., Sarassantika, I. P. E., & Suarjana, I. W. G. (2022a). Analisis Kerusakan Struktur Bangunan dan Manajemen Bencana Akibat Gempa Bumi, Tsunami, dan Likuifaksi di Palu. Bentang: Jurnal Teoritis Dan Terapan Bidang Rekayasa Sipil, 10(2). https://doi.org/10.33558/bentang.v1 0i2.3263
- Tampubolon, S. P., Sarassantika, I. P. E., & Suarjana, I. W. G. (2022b). Analisis Kerusakan Struktur Bangunan dan Manajemen Bencana Akibat Gempa Bumi, Tsunami, dan Likuifaksi di Palu. Bentang: Jurnal Teoritis Dan Terapan Bidang Rekayasa Sipil, 10(2). https://doi.org/10.33558/bentang.v1 0i2.3263
- Tampubolon, S. P., Wang, C. Y., & Wang, R. Z. (2020). Numerical simulations of the bond stress-slip effect of reinforced concrete on the push over behavior of interior beam-column joint. IOP Conference Series: Materials Science and Engineering. https://doi.org/10.1088/1757-899X/725/1/012028
- Tatya Putri Utami, & Niken Warastuti. (2019). ANALISIS KEKUATAN BANGUNAN TERHADAP GAYA GEMPA DENGAN METODE

- PUSHOVER STUDI KASUS GEDUNG ASRAMA PUSDIKLAT PPATK, DEPOK. *Jurnal Infrastruktur*. https://doi.org/10.35814/infrastrukt ur.v3i2.709
- Taufik, I., Yadi, S., & Astuti, P. (2021).
  RESPONS
  KETIDAKBERATURAN
  STRUKTUR TORSI DAN TORSI
  BERLEBIH GEDUNG 16 LANTAI
  MENGGUNAKAN METODE
  LINEAR TIME HISTORY
  ANALYSIS. Jurnal Konstruksia, 13,
  181–191.
- Tjandra, K. (2017). Empat Bencana Geologi yang Paling Mematikan. In *Gadjah Mada University Press* (Vol. 1, Issue 1).
- Triany, N., Yarra Sutadiwiria, Imam Setiaji Ronoatmojo, Bani Nugroho, Benyamin, B., Burhannudinnur, M., Yuda, H. F., & Triany, M. Y. I. M. (2022). PENGENALAN ILMU KEBUMIAN DAN **IMPLIKASINYA TERHADAP** KEBENCANAAN DAN SUMBERDAYA ALAM. **Jurnal** AKAL: Abdimas Dan Kearifan Lokal, https://doi.org/10.25105/akal.v3i2.1 3866
- Yusmar, F., Prita Melinda, A., & Sandra, N. (2021).STUDI KOMPARASI PERHITUNGAN BEBAN GEMPA STATIK EKUIVALEN MENGGUNAKAN SOFTWARE SAP 2000 DENGAN SNI 1726 2019. Jurnal Teknik. Sipil, 10(2). https://doi.org/10.24815/jts.v10i2.2 2767
- Zhai, Y., & Chen, S. (2020). A Seismic Hazard Prediction System for Urban Buildings Based on Time-History Analysis. *Mathematical Problems in Engineering*, 2020. https://doi.org/10.1155/2020/73674 34

## PERFORMANCE ANALYSIS OF HORIZONTAL IRREGULAR BUILDINGS BASED ON RESPONSE SPECTRUM AND TIME HISTORY METHOD (STUDY CASE: BUILDING MRT HUB DUKUH ATAS JAKARTA)

, (1) (0					
ORIGINA	ALITY REPORT				
1 SIMILA	<b>%</b> ARITY INDEX	13% INTERNET SOURCES	10% PUBLICATIONS	2% STUDENT PA	.PERS
PRIMAR	Y SOURCES				
1	www.scil				3%
2	"THE CAI STRUCTU BISNIS S	nmanto, Elvira E LCULATION OF JRE OF INSTITU ABDA SETIA KC knik Sipil, 2023	THE BUILDIN JT TEKNOLOG	G II DAN	<b>1</b> %
3	repositor	y.upi.edu			1 %
4	eprints.u				1 %
5	Submitte Student Paper	ed to British Un	iversity In Duk	pai	1 %
6	Yusuf, Elv	ulaya Khoiriyah vira Elvira. "DES UAKE-RESISTAN	SIGN OF		1 %

### CONCRETE STRUCTURE OF AN EIGHT-STOREY FLATS IN PONTIANAK CITY", Jurnal Teknik Sipil, 2023

Publication

7	publikasi.mercubuana.ac.id Internet Source	1 %
8	jurnal.umj.ac.id Internet Source	1%
9	N S Nugroho, Erizal, H Putra. "Structure evaluation of building based on the earthquake response acceleration spectrum of the SNI 03-1726-2019", IOP Conference Series: Earth and Environmental Science, 2021	1%
10	publisher.uthm.edu.my Internet Source	1%
11	"Minimum Design Loads and Associated Criteria for Buildings and Other Structures", American Society of Civil Engineers (ASCE), 2022 Publication	1%
12	adri.journal.or.id Internet Source	1 %
13	world.journal.or.id Internet Source	1%

journal.unj.ac.id
Internet Source

- P Y Putri, Candra. "Assessment of the <1% 15 structure of public elementary school 28 Air Tawar Timur Padang", IOP Conference Series: Earth and Environmental Science, 2021 Publication "ICCOEE2020", Springer Science and Business <1% 16 Media LLC, 2021 Publication Ashish Dhakal, Rajendra Shrestha. "Torsional <1% 17 Improvements in a Multistoried Building with Plan Irregularities", Journal of Advanced College of Engineering and Management, 2022 Publication Submitted to Sultan Agung Islamic University <1% 18 Student Paper sostech.greenvest.co.id 19 Internet Source "Guidelines for Seismic Evaluation and Design <1% 20 of Petrochemical Facilities", American Society
  - Fauzan, M W Aulia, D A Nugraha M, Z A Jauhari. "Structural assessment of the stalled building in Department of Industrial

of Civil Engineers (ASCE), 2011

**Publication** 

<1%

Engineering, Andalas University, Indonesia", IOP Conference Series: Earth and Environmental Science, 2023

Publication

Krisnamurti, Willy Kriswardhana, Achmad Wahyu Ramadiyan. "Chapter 17 Seismic Performance Analysis of Multi-story Buildings with Addition of Bracing Based on SNI 1726: 2019 (Case Study: Airlangga University Parking Building)", Springer Science and Business Media LLC, 2023

<1%

Publication

garuda.kemdikbud.go.id

<1%

Hendramawat Aski Safarizki, Dini Ayu Saputri.
"Chapter 3 Effect of Regulatory Change in
Earthquake Load Analysis on Structures with
Irregular Shapes", Springer Science and
Business Media LLC, 2023

<1%

Publication

25 iptek.its.ac.id

<1%

jurnal.batan.go.id

<1%

jurnal.unismabekasi.ac.id

<1%

perpus.usn.ac.id

Exclude quotes On Exclude matches Off

Exclude bibliography On