

Site Characterization of Marine Clay Consolidation Ratio on Kamal Muara Area, Northern Jakarta

by Lolom Evalita Hutabarat

Submission date: 01-Mar-2022 12:36PM (UTC+0700)

Submission ID: 1773637546

File name: SiteCharacterization.pdf (579.8K)

Word count: 1975

Character count: 9995

PAPER · OPEN ACCESS

Site Characterization of Marine Clay Consolidation Ratio on Kamal Muara Area, Northern Jakarta

6

To cite this article: L.E Hutabarat *et al* 2019 *IOP Conf. Ser.: Earth Environ. Sci.* **258** 012020

View the [article online](#) for updates and enhancements.



IOP | ebooks™

Bringing you innovative digital publishing with leading voices to create your essential collection of books in STEM research.

Start exploring the collection - download the first chapter of every title for free.

Site Characterization of Marine Clay Consolidation Ratio on Kamal Muara Area, Northern Jakarta

L.E Hutabarat¹, D. Rainaldo¹, T. Ilyas¹ and W.A. Prakoso¹

¹Civil Engineering, Universitas Indonesia, Depok, 16424, Indonesia

E-mail: lolom.evalita@ui.ac.id (L.E Hutabarat)

E-mail: doddy.rainaldo@ui.ac.id (D. Rainaldo)

E-mail: tommy.ilyas@eng.ui.ac.id (T. Ilyas)

E-mail: widjojo.adi@eng.ui.ac.id (W.A. Prakoso)

Abstract. Northern Jakarta coastal area is formed by some marine clay layers which has high compression as sedimentary soil. Land subsidence can occur due to several factors, such as load of building, excessive groundwater exploitation and normally consolidation process. Consolidation is a process of soil compacting due to the compression. The compression process of the soil occurs when soil receives the load from its above structure which makes a reduction of pore water pressure. Then, the dissipation of groundwater is followed by compaction of the volume of soil. A significant level of land subsidence in the coastal areas of Jakarta especially in Kamal Muara can lead to failure of building structures built on sedimentary clay soils. Therefore, research on the level of compression of sedimentary soils in the coastal areas of Jakarta needs to be done. This research is conducting by laboratory tests on UDS (undisturbed) soil samples taken by drilling a depth 50 meter point. The method used is the conso compression index litation test for further analysis of the parameters of P_c , C_r , and OCR. Testing result shows the level of marine clay soil of coastal sediment clay in Kamal Muara North Jakarta is under consolidation.

Keywords: compression index, pre-consolidation pressure, over consolidation ratio

1. Introduction

Land subsidence is a phenomenon for Jakarta, the capital city of Indonesia, indicates the damage to the building structure. In last 30 years, the subsidence occurs reached 20 – 200 cm at several places, with settlement rates reached 1 – 15 cm/years [1], [2], [3]. Land subsidence can cause by groundwater extraction, load of constructions (settlement of high compression soil), natural consolidation of alluvium soil, and earthquake forces such as broken plates of the earth [5]. From the previous study [4] groundwater extraction was the major factor caused land subsidence in urban area. However, it need to be considered that marine clay causing land subsidence due to consolidation as alluvial layers. Measurements of land subsidence using GPS measured over 3 years since 2007 [2] indicate that in the Kapuk Muara (PIKA) area in Figure 1, land subsidence that occurred in 2007-2008 reached 0.18 m per year which was then reduced to 0.11 m in 2008-2009 and 0.07 m in 2009-2010 It becomes important thing to investigate the soil characteristics in compression and the level of over consolidation ratio (OCR), so that we can learn the soil behavior for designing the foundation structure of the building which taking into account the land subsidence. Based on data of Department of Mines and Energy DKI Jakarta Province in 2012 critical condition of shallow groundwater conservation (0-40m) excluding Penjarangan areas.



Figure 1. Land Subsidence measurement using GPS in part coastal areas of Jakarta (Source: Abidin, 2008)

2. Methods

Location of research is conducted in Kamal Muara, Penjaringan, North Jakarta (Figure 2). This location is adjacent to the location where is determined by the Department of Mines and Energy DKI Jakarta Province to install extensometer testing instrument up to 300 meters depth. From previous study indicates that deep groundwater extraction (40 - 300 m) is not a major factor causing land subsidence. Geological condition of the Penjaringan area shows that the zone is dominated by embankment and alluvium (A1) which is soft soil with high moisture content. This research is using one-dimensional consolidation testing by laboratory procedure performed in a consolidometer or oedometer was first suggested by Terzaghi [5]. The bore hole up to 50 meter was drilled to determine the SPT value and take undisturbed sample (UDS) of soil from Kamal Muara. The location shown in Figure 2,

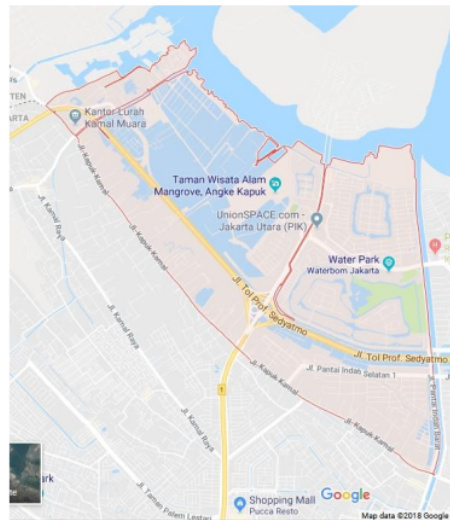


Figure 2. Research Location, Kamal Muara Penjaringan, Northern Jakarta (Source: Google Maps)

1 The soil specimen is placed inside a metal ring with two porous stones, one at the top of the specimen and another at the bottom. The specimens are 64 mm in diameter and 20 mm thick. The load on the specimen is applied through a lever arm, and compression is measured by a

micrometer dial gauge. The specimen is kept under water during the test, to make sure that the specimen is in the saturated condition. Each load is kept for minimum 18 hours. Doing the loading procedure until effective stress is zero (P_0), then reloading procedure. The objective of this result is to find the pre consolidation pressure of a specimen (P_c), the re-compression index (C_r), and the over consolidation ratio (OCR) parameters of the soil samples.

Pre-consolidation pressure of a specimen or past maximum vertical effective stress, P_c , is the maximum vertical effective stress that a soil was subjected to in the past. Pre-consolidation pressure is determined by simple graphic plotting e - $\log a'$ graphic, suggested by Casagrande [6] [7], from laboratory testing result of consolidation test.

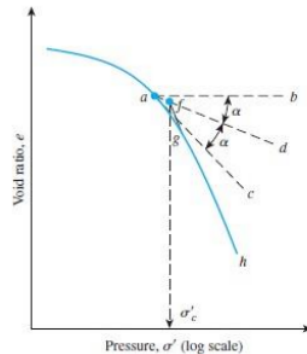


Figure 3. Preconsolidation pressure graphs (Casagrande, 1936)

Recompression index or unloading/reloading index, C_r , is the average slope of the unloading/reloading curves in a plot of the logarithm of vertical effective stress versus void ratio. There are some relationships between simple soil tests and consolidation settlement parameters are given below.

Typical range of values

$$C_c = 0.1 \text{ to } 0.8$$

$$C_r = 0.015 \text{ to } 0.35; \text{ also, } C_r \approx C_c/5 \text{ to } C_c/10$$

$$C_c/C_c = 0.03 \text{ to } 0.08$$

Empirical relationships

$$C_c = 0.009 (LL - 10)$$

$$C_c = 0.40(e_o - 0.25)$$

$$C_c = 0.01(w - 5)$$

$$C_c = 0.37(e_o + 0.003 LL - 0.34)$$

$$C_c = 0.00234 LL G_s$$

$$C_r = 0.15(e_o + 0.007)$$

$$C_r = 0.003(w + 7)$$

$$C_r = 0.126(e_o + 0.003 LL - 0.06)$$

$$C_r = 0.000463 LL G_s$$

$$C_c = 1.35 PI \text{ (remolded clays)}$$

Reference

Terzaghi and Peck, 1967

Azzouz et al., 1976

Azzouz et al., 1976

Azzouz et al., 1976

Nagaraj and Murthy, 1986

Azzouz et al., 1976

Azzouz et al., 1976

Azzouz et al., 1976

Nagaraj and Murthy, 1985

Schofield and Wroth, 1968

w is the natural water content (%), LL is the liquid limit (%), e_o is the initial void ratio, and PI is the plasticity index.

Figure 4. Variation of C_c and C_r

Thus, over consolidation ratio, OCR, is the ratio by which the current vertical effective stress in the soil was exceeded in the past. The degree of over consolidation, called over consolidation ratio, is defined as:

$$OCR = \frac{\sigma'_c}{\sigma'_o} \quad (1)$$

where σ'_c = P_c = pre consolidation pressure
 σ'_o = present effective vertical pressure

3. Results

Laboratory testing result of physical properties of Kamal Muara sedimentary soil is showed in table below:

| Depth (m) | Unit Weight (kN/m ³) | Moisture Content (%) | Void Ratio (e) |
|-------------|----------------------------------|----------------------|----------------|
| 4.00-4.50 | 15.24 | 78.66 | 1.20 |
| 5.50-6.00 | 14.41 | 101.98 | 1.47 |
| 7.00-7.50 | 14.49 | 101.60 | 1.47 |
| 9.00-9.50 | 14.53 | 106.05 | 1.54 |
| 40.00-40.50 | 16.22 | 23.30 | 0.38 |
| 41.50-42.00 | 18.14 | 41.05 | 0.75 |
| 43.50-44.00 | 18.22 | 82.49 | 1.5 |
| 44.50-45.00 | 18.21 | 38.47 | 0.70 |

It is clearly seen that soil has high moisture content. Correlation between the moisture content and void ratio showed in the table below: Rate of Consolidation in each layer as follow:

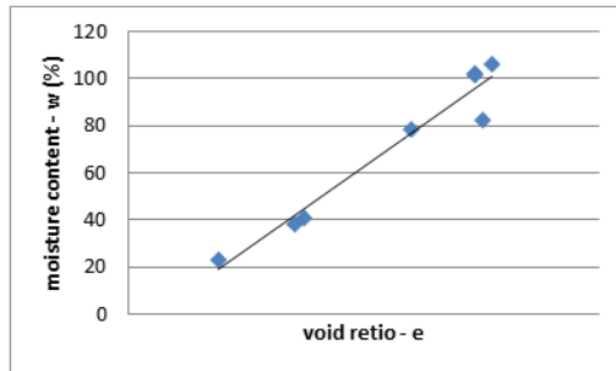


Figure 5. Correlation of moisture content versus void ratio

4. Discussion

As shown in Table 2, the soil layer below 4.5 m are under consolidation rate, it can be seen from Table 2 as follow

| Depth (m) | Po (kN/m ²) | Pc (kN/m ²) | OCR | Consolidation Rate |
|-------------|-------------------------|-------------------------|------|---------------------|
| 4.00-4.50 | 0.11 | 0.79 | 7.18 | over consolidation |
| 5.50-6.00 | 0.18 | 0.17 | 0.94 | under consolidation |
| 7.00-7.50 | 0.21 | 0.19 | 0.91 | under consolidation |
| 9.00-9.50 | 0.26 | 0.19 | 0.73 | under consolidation |
| 40.00-40.50 | 0.75 | 0.45 | 0.60 | under consolidation |
| 41.50-42.00 | 1,02 | 0.62 | 0.61 | under consolidation |
| 43.50-44.00 | | | | under consolidation |
| 44.50-45.00 | 1,57 | 0.34 | 0.22 | under consolidation |

And the estimation of recompression index or unloading/reloading index, Cr for each layer are vary that can be seen from the table below:

Table 3. Result of recompression index - Cr

| Depth (m) | e _o | w (%) | Cr (graph) | Cr (#1) | Cr (# 2) |
|-------------|----------------|--------|------------|----------|----------|
| 4.00-4.50 | 0.0012 | 78.66 | 0.008542 | 0.001229 | 0.031146 |
| 5.50-6.00 | 0.0015 | 101.98 | 0.016380 | 0.001270 | 0.032079 |
| 7.00-7.50 | 0.0015 | 101.60 | 0.005163 | 0.001270 | 0.032063 |
| 9.00-9.50 | 0.0015 | 106.05 | 0.051495 | 0.001281 | 0.032242 |
| 40.00-40.50 | 0.0004 | 23.30 | 0.110286 | 0.001106 | 0.028932 |
| 41.50-42.00 | 0.0007 | 41.05 | 0.05175 | 0.001161 | 0.029642 |
| 43.50-44.00 | 0.0015 | 82.49 | 0.054307 | 0.001275 | 0.031299 |
| 44.50-45.00 | 0.0007 | 38.47 | 0.067816 | 0.001155 | 0.029539 |

5. Conclusion

Land subsidence has been identified as one of major geological hazards of Jakarta. Based on the result of laboratory testing show the level of marine clay compressibility index of coastal sediment clay in Kamal Muara North Jakarta are under consolidation so that in certain areas the land subsidence that occurs is still ongoing due to the consolidation process from the land. Land subsidence occurring in the area of Penjaringan and Pademangan areas is estimated to be in the conservation of shallow ground water (0 - 40 m) which is in the level under consolidation. The surface layer up to 4,5 m shows that the zone is dominated by embankment with overconsolidation level.

5

Acknowledgements

Acknowledgments and gratitude to all the parties who have assisted and supported the research of Site Characterization of Marine Clay Compression Index on Kamal Muara Area, Northern Jakarta, especially to research grant from PITTA Universitas Indonesia with Contract No. 2548/UN2.R3.1/HKP.05.00/2018

Appendix

[1] A. H. M. Ng, L. Ge, X. Li, H. Z. Abidin, H. Andreas, dan K. Zhang, "Mapping land subsidence in Jakarta, Indonesia using persistent scatterer interferometry (PSI) technique with ALOS PALSAR," *Int. J. Appl. Earth Obs. Geoinf.*, vol. 18, no. 1, hal. 232–242, 2012.

[2] H. Z. Abidin, H. Andreas, R. Djaja, D. Darmawan, dan M. Gamal, "Land subsidence characteristics of Jakarta between 1997 and 2005, as estimated using GPS surveys," *GPS Solut.*, vol. 12, no. 1, hal. 23–32, 2008.

[3] E. Chaussard, F. Amelung, H. Z. Abidin, dan S. H. Hong, "Sinking cities in Indonesia: ALOS PALSAR detects rapid subsidence due to groundwater and gas extraction," *Remote Sensing Environment*., vol. 128, hal. 150–161, 2013.

[4] L. E. Hutabarat dan T. Ilyas, "Mapping Of Land Subsidence Induced By Groundwater Extraction In Urban Areas As Basic Data For Sustainability Countermeasures," *Int J. Technology*., vol. 6, hal. 1001–1011, 2017.

[5] S. Bertrand, L. Doner, S. Acker, "Sedimentary record of coseismic subsidence in Hersek coastal lagoon (Izmit Bay, Turkey) and the late Holocene activity of the North Anatolian Fault." *Geochemistry, Geophysics, Geosystems* **12**(6), 2011

[6] B.M Das, "Principles of Geotechnical Engineering", Adapted Int Student Edition, Thomson, p.137, 2007

[7] A. Casagrande, "The determination of pre-consolidation load and it's practical significance." In *Proc. Int. Conf. Soil Mech. Foundation Engineering Cambridge, Mass, 1938* Vol 3, p.60, 1936

Site Characterization of Marine Clay Consolidation Ratio on Kamal Muara Area, Northern Jakarta

ORIGINALITY REPORT

| | | | |
|------------------|------------------|--------------|----------------|
| 17% | 17% | 9% | 12% |
| SIMILARITY INDEX | INTERNET SOURCES | PUBLICATIONS | STUDENT PAPERS |

PRIMARY SOURCES

| | | |
|----------|-----------------------------------------------------------------------|-----------|
| 1 | Submitted to Liverpool John Moores University Student Paper | 4% |
| 2 | epdf.pub Internet Source | 3% |
| 3 | Submitted to Universitas Negeri Semarang Student Paper | 3% |
| 4 | www.researchgate.net Internet Source | 3% |
| 5 | www.scitepress.org Internet Source | 2% |
| 6 | Repository.Unej.Ac.Id Internet Source | 2% |

Exclude quotes On

Exclude matches < 2%

Exclude bibliography On